

STERER

1602 CORPORATE DRIVE, P.O. BOX 67, WARRENSBURG, MISSOURI 64093 PHONE 660-747-8183 FAX 660-747-8650

Manufacturing quality lawn care equipment since 1945

Made In The

# LIMITED WARRANTY


The manufacturer's warranty to the original consumer purchaser is: This product is free from defects in materials and workmanship for a period of one (1) year from the date of purchase by the original consumer purchaser. We will repair or replace, at our discretion, parts found to be defective due to materials or workmanship. This warranty is subject to the following limitations and exclusions:


1) Commercial Use	The warranty period for any product used for commercial or rental is limited to ninety (90) days from the date of original purchase.
2) Limitations	This warranty applies only to products which have been properly assembled, adjusted, and operated in accordance with the instructions contained within this manual. This warranty does not apply to any product of Swisher Mower Co., Inc., that has been subject to alteration, misuse, abuse, improper assembly or installation, or shipping damage.
3) Exclusions	Excluded from this warranty are normal wear, normal adjustments, and normal maintenance.

Item #	Part #	Description
1	10113	Deflector - Spreader
2	NB505	Bolt - 5/16-18 X 1 1/2 HCC GR5 ZY
3	NB556	Washer - USS Flat, 5/16 ZY
4	NB579	Washer - Fender, 5/16 X 1 1/4 OD ZY
5	7825Z	Bushing - Lift Bar
6	10051	Spring - Gate, 12V ATV Spreader
7	NB555	Washer - USS Flat, 1/2 ZY
8	10112TK	Gate - Hopper
9	10111TK	Bracket - Motor Support, Upper
10	NB181	Nut - Nyloc 5/16-18 ZY
18	10192	Washer - Nylon Retainer 5/16"
20	10975	Tank - Truck Spreader
-	-	· · · · · · · · · · · · · · · · · · ·

#### Step 1:

Assemble the components as shown. Use the Nylon Retainer Washer (18) to hold the parts together.

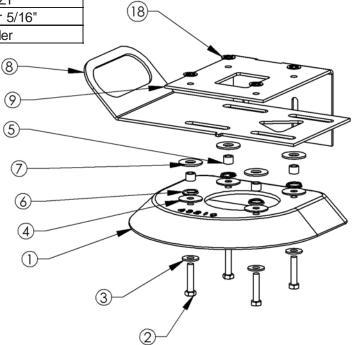

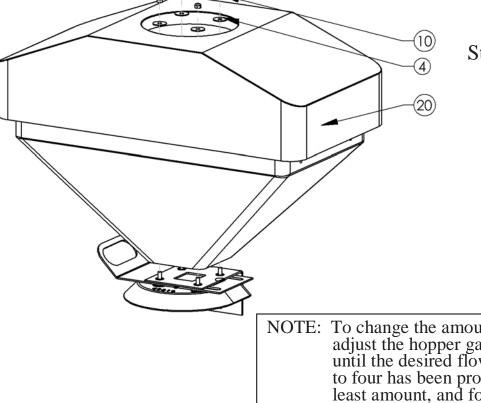

Step 2:

Attach the assembly made in Step 1 to the tank (20) by sliding the bolts (2) up through the tank and placing a fender washer (4) over each bolt. Thread a nut (10) over each bolt and tighten securely.

NOTE: To change the amount of material being spread, adjust the hopper gate by pulling on the handle until the desired flow is attained. A scale of one to four has been provided with one being the least amount, and four being the most. Zero will seal the material from being distributed.

	Devit //	Description	г	
Item #	Part #	Description		
9	10111TK	Bracket - Motor Support, Upper	-	
11 12	10114TK	Bracket - Motor Support, Lower		
12	10197 10117TK	Bolt - Carriage 5/16-18 X 1 GR5		
13	3844	Shield - Spreader		
14	15118	Knob - T, 5/16-18 Motor - Spreader 12 VDC CW 2.5"		
15	10118	Spinner - Distributor, Spreader		
10	10110			
		•		
Step	3:			
Re	move the nu	its and snap ring from	- fi	
		place the Lower Motor		
		L		
		et (11) over the Motor (15).		
Th	read the nut	s onto the motor studs and		
tig	hten. Slide	the Spinner/Distributor (16)		
		shaft and replace roll pin.	DETAIL B	
011	er the motor	shurt und replace fon pin.	SCALE 1:5	
			~~~~	
Step 4:				
Insert the 5/16" Carriage Bolts (12)				
into the Lower Motor Bracket (11),				
			$\Gamma$	
throu	gh the Uppe	r Motor Bracket (9),		
and the	nrough the S	preader Shield (13).		
Place	the T-Knob	s (14) on the bolts (12)		
and tighten. (The guide of the				
Lower Bracket will slide up				
through the slot in the Upper				
Bracket).				
	,			
			<u> </u>	
		(15) - (15)	X	
NOTE	To change the	radius of	X	
NOTE: To change the radius of material being spread, simply				
loosen the T-Knobs and slide				
the mechanism up (smaller				
]	radii) or down	(larger radii).		

Item #	Part #	Description
3	NB556	Washer - USS Flat, 5/16 ZY
10	NB181	Nut - Nyloc 5/16-18 ZY
21	10976TK	Support - Weldment, LH; Truck Spreader
22	10979TK	Support - Weldment RH; Truck Spreader
24	NB501	Bolt - 5/16-18 X 1 HCC GR5 ZY
25	NB579	Washer - Fender, 5/16 X 1 1/4 OD ZY GR2

10)


60

21

Step 5:

Attach the Support Tube Weldments (21 & 22) to the tank by inserting the bolts (24) through the Washers (25) and the Weldments (21 & 22), and into the holes on the side of the tank as shown. Place a washer (3) over each bolt (24) on the inside of the tank and thread the nuts (10) onto the bolts (24) and tighten securely.

24)

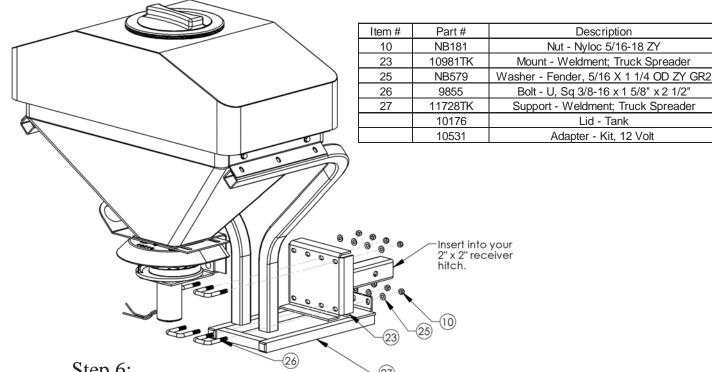

Step 6:

Attach the Mounting Weldment (23) to the Spreader Assembly by putting the U-Bolts (26) over the Mounting Tubes (21 & 22) and into the holes on the Mounting Weldment (23). Mount the Support Weldment (27) onto the rear of the Mount Weldment (23) and place the Washers (27) onto the Bolts (26) as shown and thread the Nuts (10) in place. Making sure that the support tubes are resting on the lip provided, tighten the nuts, securing the Mounting Weldment (23) and Support Weldment (27) to the Spreader Assembly.

Power Hook-Up:

After assembling the Spreader, you must hook up the 12 Volt Spreader Motor. To do this you must first route the wires coming out of the male end of the 12 Volt Power Source through your Truck, and back to the rear of your truck. (be sure to allow enough wire to be able to plug and unplug the power source from the receiver located on your truck). Next, tie the wires from the motor through the holes located on the bottom of the Spreader Shield using the nylon tie supplied. Connect these wires to the ones coming from the 12 Volt Power Supply.\*

To operate, simply plug in the 12 Volt Power Supply, and begin using your Swisher Spreader.

\*Note: When hooking up the electrical, test the rotation of the motor shaft. Looking down on the motor shaft, the shaft should rotate clockwise. If the direction is counter clockwise, switch the wires coming out of the motor that plug into the 12 volt power source.

### MATERIAL SPREADING CHART

(Calibrated at 4 MPH Ground Speed)

PRODUCT	Setting #1	Setting #2	Setting #3	Setting #4	SPREAD WIDTH	
Fastilians	41 lbs/Acre @ 4 mph	169 lbs/Acre @ 4 mph	NA	NA	12 ft	
Fertilizer	20 lbs/Acre @ 8 mph	84 lbs/Acre @ 8 mph	NA	NA	12,11	
Rock Salt	NA	NA	226 lbs/Acre @4 mph	352 lbs/Acre @4 mph	- 12ft	
ROCK Salt	NA	NA	113 lbs/Acre @8 mph	176 lbs/Acre @ 8 mph		
Dry Sand	151 lbs/Acre @4 mph	536 lbs/Acre @4 mph	]NA	NA	9ft	
	75 lbs/Acre @8 mph	268 lbs/Acre @8 mph	NA	NA		
Barley	NA	56 LBS/Acre @4 mph	170 lbs/Acre @4 mph	NA	- 12ft	
	NA	28 lbs/acre @8 mph	85 lbs/Acre @8 mph	NA		
Oats	NA	82 lbs/Acre @4 mph	288 lbs/Acre @4 mph	NA	12ft	
	NA	41 lbs/Acre @ 8 mph	144 lbs/Acre @ 8 mph	NA		
Red Fescue	NA	53 lbs/Acre @4 mph	NA	INA	7ft	
	NA	26 lbs/Acre @8 mph	NA	NA	711	

- Above Spreader Chart settings are approximate, always trial test applications rate.

- All measurements are taken with the motor spinner at the furthest setting from the deflector shield.

- Formula for calibration of other products not listed above:

Flow Rate (Ibs/min)	х	lbs/Acre
Coverge (Sq-Ft/min)	~	43560 (sq-ft (1 acre))

Flow Rate (Ibs/min): Material (Ibs/min) that flows through selected hopper gate setting per minute. (Motor and spinner removed with lower mount plate #11)

Coverage (sq-ft/min): Material spread width (Trial test required) multiplied by Distance traveled/min. (IE 4 mph = 352 ft/min; 3 mph = 264 ft/min; 2 mph = 176 ft/min; 1 mph = 88 ft/min)

## HELPFUL TIPS

- Read Owners Manual before use and be sure to follow all safety label cautions provided on the Spreader Hopper.
- Always use **ONLY CLEAN DRY MATERIAL** and be sure to remove all unused material from the hopper after each use. Damp materials will cause material flow problems and material freezing problems in cold temperatures.
- Be sure material is free of foreign matter such as packaging etc.
- Some materials may jam the hopper gate at lower settings so it may be necessary to use a larger setting and increase your MPH to compensate for the increased material flow rate. IE increasing your ground speed from 4Mph to 8Mph will decrease your application rate per acre by half if the same gate setting is used at both speeds.
- Light seed such as Kentucky Blue Grass can be mixed with a seed such as clover to aid in material flow at a 50/50 mix.
- Increased material density per acre can be achieved by adjusting the motor spinner closer to the deflector shield and hopper gate. This accomplishes a narrower spread width providing more pounds/square foot of material.
- Be sure not to attempt spreading light seeds in windy conditions; as poor coverage will result.
- Proper material coverage is achieved with the greatest satisfaction by covering the desired area twice at half the recommended application rate indicated by the manufacturer of the material. Once by traveling length ways then by subsequently by traveling cross ways to account for any underlap issues. The adjustment of the application rate can be made by either adjusting the hopper gate to a lesser setting; or increasing the ground speed of the application vehicle.
- When using the spreader for salt/icemelters/fertilizer or other corrosive materials it is imperative that the spreader is thoroughly cleaned to prevent corrosion causing premature failure of the product.



MANUFACTURING QUALITY LAWN CARE EQUIPMENT SINCE 1945

Ourner's Manual Model Numbers Truck Spreader 1730

**Before Operating this** 

Equipment.

#### WHEN ORDERING PARTS, PLEASE HAVE THE FOLLOWING INFORMATION AVAILABLE:

TELEPHONE - 1-800-222-8183 FAX - 1-660-747-8650

*SWISHER MOWER & MACHINE CO. INC.* 1602 CORPORATE DRIVE P.O. BOX 67 WARRENSBURG, MO 64093

<u>swisherinc.com</u>